


# JX-P510

# POSITION TRANSDUCER

# INSTALLATION GUIDE

## DIMENSIONAL INFORMATION

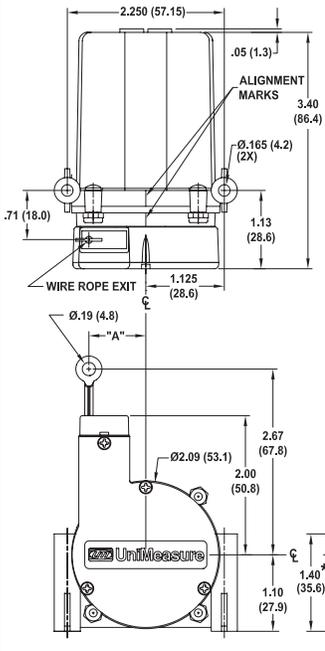


### RANGES TO 50" (1250 MM)

**TABLE A**

RANGE	Dim A		Nominal Cable Tension	
	(in)	(mm)	(oz)	(N)
2, 10	.36	9.1	16	4.4
2.8, 15, 30	.50	12.7	14	3.9
3.8, 20, 40	.66	16.7	11	3.1
4.7, 25, 50	.82	20.8	8	2.2

**FIG 1**

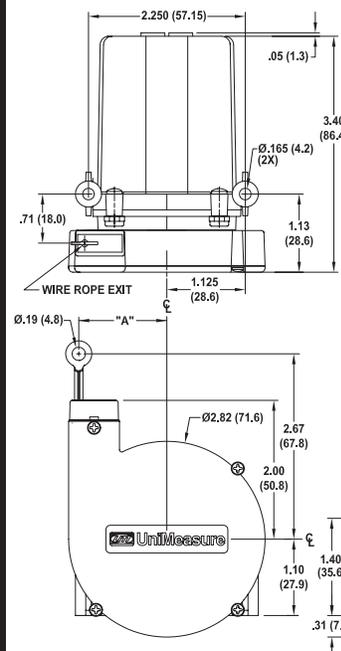

### RANGES 60 & 80" (1250 MM)

**TABLE B**

RANGE	Dim A		Nominal Cable Tension	
	(in)	(mm)	(oz)	(N)
60	.98	24.9	10	2.8
80	1.28	32.5	8.6	2.4

**FIG 2**

Dimensions in brackets are millimeters.

\*Mounting screws must accommodate this distance.

Dimensions in brackets are millimeters.

\*Mounting screws must accommodate this distance.

## SPECIFICATIONS

Output ..... 0 to 10 VDC or 0 to 5 VDC  
 Alternatively  $\pm 5$  or  $\pm 10$  VDC  
 Excitation Voltage ..... 4.9 to 30 VDC  
 Excitation Current ..... 25 mA maximum  
 Output Load ..... 5K ohm minimum  
 Output Impedance ..... 10 ohm maximum  
 Protection ..... Reversed Polarity Input  
 Linearity: Ranges to 4.7" .....  $\pm 1.0\%$  Full Scale  
 10" to 25" range .....  $\pm 0.5\%$  Full Scale  
 30" to 80" range .....  $\pm 0.25\%$  Full Scale  
 Operating Temperature ..... -25°C to 75°C

## MOUNTING

- To maximize wire rope life, align transducer with moving element so that wire rope exits perpendicular to axis of wire rope exit hole within 2° (See FIG 3).
- Use Table A or B to determine wire rope exit location relative to transducer mounting holes.
- Mount unit with two #8 or two M4 (or smaller) pan head machine screws. On units with ranges of 60" (1500 mm) or 80" (2000 mm), place spacer blocks under mounting surface (See FIG 2). Torque 8-32 screws to 8 lb-in maximum. Torque M4 screws to 0.80 N-m maximum.




**FIG 3**

## REPLACEMENT WIRE ROPE WIPERS

The JX transducer contains wire rope dust wipers which are located just beneath the wire rope exit location. Periodic replacement of the dust wipers may be necessary depending upon the amount of dust in the operating environment. To access the dust wipers, remove the dust wiper cover by placing a small blade screwdriver into the slot as shown in FIG 4 and pry upward while squeezing the ends of the cover. The wipers may be removed with tweezers and cleaned or replaced. The replacement wiper kit which contains six pair of prelubricated wipers is UniMeasure part number 10198.

To install replacement wipers, place a wiper into wiper opening on both sides of the wire rope. Press wiper cover into place until detented.

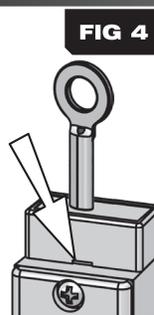

**FIG 4**

## ZERO & SPAN POTENTIOMETER ADJUSTMENT

To adjust the zero and span, first remove the two Phillips head screws from the potentiometer access holes located on the end of the transducer (See FIG. 7). Visually locate the adjustment screws on each potentiometer. The screws are very small and will require a small blade type screwdriver (.06" (1.5mm) max. blade width x .016" (.4mm) max. blade thickness) for the adjustment.

### 0 TO 5 VDC OR 0 TO 10 VDC OUTPUT


Rotate the shaft of the transducer to the desired zero position (must be within 0% to 30% of range) and adjust the Zero potentiometer to give 0 VDC output. Rotate the shaft to the desired maximum position (must be within 80% to 100% of range) and adjust the Span potentiometer to the desired maximum output of 5 or 10 VDC. Since the zero and span controls are somewhat interactive, recheck the zero and span settings and adjust as necessary. Insure that a sealing o-ring (See FIG. 7) is on each of the two Phillips head screws. Thread each screw into each potentiometer access hole until the head of the screw bottoms against the raised shoulder. Do not tighten the screw against the shoulder.

### $\pm 5$ VDC OR $\pm 10$ VDC OUTPUT

Rotate the shaft of the transducer to the desired zero position (must be between 40% and 60% of maximum range) and adjust the Zero potentiometer to give 0 VDC output. Rotate the shaft to the desired maximum position (must be within 80% to 100% of range) and adjust the Span potentiometer to the desired maximum output of 5 or 10 VDC output. Since the zero and span controls are somewhat interactive, recheck the zero and span settings and adjust as necessary. Insure that a sealing o-ring (See FIG. 7) is on each of the two Phillips head screws. Thread each screw into each potentiometer access hole until the head of the screw bottoms against the raised shoulder. Do not tighten the screw against the shoulder.


## ROTATION OF WIRE ROPE EXIT

To rotate wire rope exit location, loosen four screws (See FIG 5, which retain mechanism to mounting housing). Note that alignment marks on mechanism occur at 45° intervals. Rotate housing to desired position and torque screws to 50 oz-in (0.35 N-m).

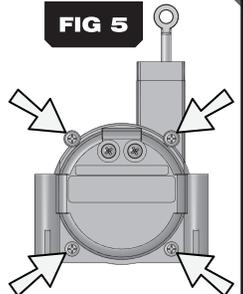

**FIG 5**

## ZERO & SPAN POTENTIOMETER ACCESS

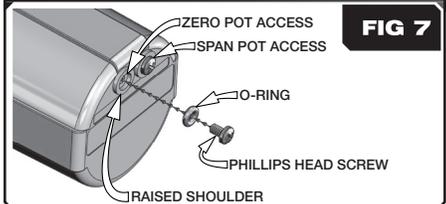


**FIG 7**

## CONNECTOR WIRING

As viewed on transducer and on cable attachment side of mating connector.



## ELECTRICAL CABLE WIRING

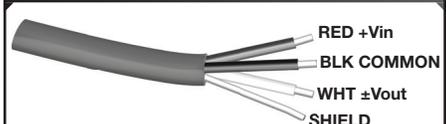

**um UniMeasure**

4175 SW Research Way, Corvallis, Oregon, 97333  
 Tel: (541) 757-3158 Fax (541) 757-0858

FOR SENSITIVITY INFORMATION, SEE OPPOSITE SIDE