
## **UniMeasure**


## WIRE ROPE REPLACEMENT **JX SERIES**

NYLOK NUTS (4)

- Referring to Figure 1, remove the capstan cover by removing the four attaching 1. screws.
- 2. With small blade type screwdriver, unclip the wiper cover shown in Fig. 1 and remove the two dust wipers.
- Remove Mounting Base by removing four screws as shown in Fig. 2 and sliding 3. Mounting Base away from mechanism.
- Using a .050" hex driver, loosen the set screw securing the potentiometer and slide 4. the potentiometer out of the main shaft (Fig. 4).
- Referring to Fig. 3, with fingers restrain capstan from rotating and 5. loosen screw on capstan. Remove wire rope. Allow retraction spring to slowly unwind capstan.
- Feed new wire rope included in repair kit through the two guide holes 6. in capstan housing.
- Wind spring of transducer 17 revolutions by rotating capstan clockwise 7. (as viewed from capstan end of transducer).
- Feed wire rope through hole in surface of capstan (Fig. 3). 8.
- Using thin bladed tweezers, pull wire rope through slot in web of capstan and wrap around screw. 9. Tighten screw to 50 oz-in. (0.35 N-m) to secure wire rope to capstan (Fig. 3).
- 10. Holding tension on wire rope, carefully let tension of spring reel the wire rope onto capstan.
- 11. Viewing shaft end of the potentiometer, rotate shaft counter-clockwise to stop.
- 12. Insert potentiometer into shaft of transducer, with anti-rotate arm aligned with alignment screw shown in Fig. 4.
- 13. Turn the potentiometer counter-clockwise until the anti-rotate rod is slightly past the antirotate slot (Fig. 4).
- 14. Tighten set screw, securing potentiometer to shaft.
- 15. Rotate potentiometer clockwise while deflecting anti-rotate rod enough to drop into slot in transducer housing (Fig. 4).
- 16. Place new wipers in wire rope guide area. Snap wiper cover into position.
- 17. Assemble Mounting Base to transducer body and torque fasteners to 50 in-oz. (0.35 N-m)
- 18. Install Capstan Cover and tighten screws finger tight.
- 19. Wire rope replacement is complete.



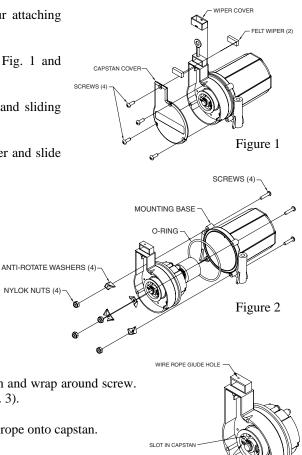

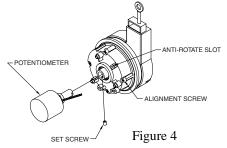

CAPSTAN SCRE